

Blue

Work Order ID 55777



Page 1

February 1, 2010 10:22:17 AM

Item ID: D206-642-441

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00



Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan:

*RP*Date: *10-2-09*

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D2650

Rev F

100

0.00



DOCUMENT CONTROL

DC

0.00

Memo

Document Control

Photocopy bluefile and create labels per PPP D206-642-441 CHG002

N/A

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM



Page 2

Item ID: D206-642-441

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00



Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110	Skidtubes	0.00							
	Skidtubes								
Skidtubes	Memo	0.00							
Skidtubes	1-Deburr Fwd edge of tube								
	2-Remove ridge on inside of Fwd edge of tubeas per Dwg D2650								
	3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.								
	A/R: Aluminum Rod: <u>M112507/M113207</u>								
	4-Grind weld flush to cap on top surface only.								
	5-Cut aft end 138.60" from front of tube								
	6-Drill pilot holes using drill jig DT8025 & DT8169 (A,B,C,D). Open to Ø0.312".								
	7-Drill holes for wearplates using DT 8028-7. Open to Ø 0.297".								
	8-Open using #6 Drill Bit								
	9-Open holes for Tow Ring to Ø0.625" as per Dwg D2650, D2650-7 Drilling Detail								
	10-Remove inner indexing ridge on aft end of skidtubeas per Dwg D2650								
	11-Deburr and Blow out all chips form inside the tube								

BE 10/02/02

BE 10/02/03

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM



Page 3

Item ID: D206-642-441

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00



Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00

Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

115

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

2) S 10/02/03

Quality Control

116

QC10- Inspect visual per QSI004- ground welds

0.00



QC

Memo

0.00

2) S 10/02/03

(40)

Quality Control

120

Chemical Conversion Coat per QSI005 4.1

0.00



HandFinish

Memo

0.00

(4)

BE 10/02/03

Hand Finishing

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM



Page 4

Item ID: D206-642-441

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00



Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: Date: Tooling: Date:

Stop



QC: Date: SPC (Y/N): Date:

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

10-2-3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM

Page 5

Item ID: D206-642-441

Accept

Setup Start

Revision ID:

Stop

Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00

Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Open holes to finished size as per Dwg D2650, D2650-7 Drilling Detail
(without cutting fluid)

2-Countersink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

4-Bond D2654-7 web in place as per QSI 015Ensure holes line upAllow 12 Hrs.
cure time before cutting□
Start Date: 10/02/03 □Time: □ 1:00□
Finish Date: 10/24 □ 10/24Time: □ 8:55 amA/R □ SikaFlex-291 □ M112429 □ □SikaFlex expiry date: □ 08/2010

3 BE10/02/03

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM



Page 6

Item ID: D206-642-441

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00



Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: Date: Tooling: Date:

QC: Date: SPC (Y/N): Date:

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

150

QC5- Inspect part completeness to step on W/O

0.00

S 10/02/04



QC

Memo

0.00



Quality Control

160

Skidtubes

0.00



Skidtubes


Memo

0.00

1-Prep per QSI 005 and Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.
A/R Aluminum Rod M112507

2-Grind welds flush as per Dwg D2650.

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650 Deburr

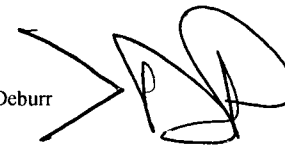

BE 10/02/08

10-2-8

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM

Page 7

Item ID: D206-642-441

Accept

Setup Start

Revision ID:

Stop

Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00

Required Date: 2/19/10 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

QC: Date: SPC (Y/N): Date:

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

170



Skidtubes

Skidtubes

HandFinishing

Memo

Install D2680-041 Nut Plate as per Dwg D2650

0.00

0.00

DP 10-2-16

180



QC

Quality Control

QC10- Inspect visual per QSI004- ground welds

Memo

0.00

0.00

8.10/02/17

190



QC

Quality Control

QC5- Inspect part completeness to step on W/O

Memo

0.00

0.00

8.10/02/17

④

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM

Page 8

Item ID: D206-642-441

Accept

Setup Start

Revision ID:

Stop

Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00

Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00

Customer:

Reference:

Run Start

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

200

Pressure Wash per QSI005 4.3

0.00

BR 10-02-17

①



HandFinish

+ Touch up Alodine' Resists
Memo Suled 17

0.00

Hand Finishing

210 205

spray paint

White Gloss (Ref 4.3.5.1) per QSI005 4.3 Alum

0.00



Powdercoat

Powder Coating

Memo

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

prime grey per QSI005 B-110918
print Deflect Blue B-113171
clear Deflect B-113314

0.00

0.00

0.00

0.00

220

QC3 - Inspect Part Finish

0.00



QC

Quality Control

Memo

0.00

ml 10 02 23 ①

10-02-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM



Page 9

Item ID: D206-642-441

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00



Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Draw
Number

Draw
Rev.

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

230



HandFinish

HandFinishing

0.00

0.00

Memo

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R ☐ Sikaflex-291 ☐ 11112391 ☐

Sikaflex expiry date: ☐ 10/01

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R ☐ Sikaflex-291 ☐ 11112391 ☐

Sikaflex expiry date: ☐ 10/01

6-Wing Walk as per Dwg D2650-7 and QSI 005 4.4

Batch: 11113462

10/03/01 (X1) 9

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 55777

February 1, 2010 10:22:17 AM



Page 10

Item ID: D206-642-441

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 2/02/10 Start Qty: 1.00



Cust Item ID:

Required Date: 2/19/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: Date: Tooling: Date:

Stop



QC: Date: SPC (Y/N): Date:

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

240



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

E 10/03/02

Memo

0.00



250



Packaging

Packaging

Packaging

0.00

Memo

0.00

Identify and pack for shipping as per PPP D206-642-441

Location:

PPP Rev:

FAR 55765

10/03/02 E

260



QC

Quality Control

QC21- Final Inspection - Work Order Release

0.00

Memo

0.00

10/03/05
MF
10-3-5

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Page 1
10

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
IPP Rev:I 08-05-01 add QC3 DD verified by:EC
IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
D2620		Manufactured	No			110	Each	17.0000	1.0000			
Skidtube, 206 Skidtube												

Warehouse Loc Qty Loc Code
Location

Main Warehouse

ST 17

54448 7

55559 10

1 BE 10/02/02

D2646

Manufactured No

110 Each 58.0000 1.0000



Aft Cap

Warehouse Loc Qty Loc Code
Location

Main Warehouse

FP6 29

52663 29

Main Warehouse

fp7 13

52663 13

Main Warehouse

ST 16

46327 4

48109 12

xl 10/03/01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Page 2

Work Order ID: 55777

Parent Item: D206-642-441

Parent Item Name: Replacement Skidtube



Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Date: 2/02/10

Required Date: 2/19/10

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ D2647	Replacement	Mfg/ Manufactured	Bin No	Primary	Last	Route 140	Unit of Each	Qty on 93.0000	Remaining 1.0000	Qty	Date	Status
												
Cap												

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

93

55352

93

160

Each

2.0000

1.0000

1 LG 10/02/02

D2654-7

Manufactured

No



Web

Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

FG

2

52801

2

170

Each

41.0000

2.0000

255801 (P) BE 10/02/03

CCR264SS3-3

Purchased

No



Cherry Rivet

Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

ST

41

111548

20

111827

1

112314

2

113539

18

M113973

(2)

DD

10-2-16

February 1, 2010 10:22:21 AM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
D2649		Manufactured	No			170	Each	337.0000	23.0000			
Cross Bolt Spacer												

Warehouse Loc Qty Loc Code
Location

Main Warehouse

LG 310
 51529 3
 55000 307

3
20 SE 10/02/04

Main Warehouse

ST 27
 36013 5
 47112 18
 48271 4

D2680-041 Manufactured No

170 Each 57.0000 1.0000



Nut Plate

Warehouse Loc Qty Loc Code
Location

Main Warehouse

ST021 57
 33061 1
 55366 56

(i)

10-2-8

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
ALS4-1032-130		Purchased	No			230	Each	2,253.000	60.0000			



Insert

Warehouse
Location

Main Warehouse

ST

2253

(110511)

2253

AN960JD10L

Purchased

No

230

Each

3,815.000

62.0000



Washer

Warehouse
Location

Main Warehouse

ST

3815

101291

16

105793

49

(110985)

3750

AN960JD416

Purchased

No

230

Each

0.0000

1.0000



Washer

X M 113288

X60 M 10/03/01

X62 M 10/03/01

X1 M 10/03/01

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 5

February 1, 2010 10:22:21 AM

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
CR3212-4-03		Purchased	No			230	Each	250.0000	2.0000			
Cherry Rivet												

Warehouse	Loc Qty	Loc Code
Location		
Main Warehouse		
ST	250	
111359	84	
112314	166	

Handwritten: 10-28

D2651-1



Plug

Manufactured No

230	Each	504.0000	22.0000

Warehouse	Loc Qty	Loc Code
Location		
Main Warehouse		
fpa	295	
53349	295	
Main Warehouse		
ST	209	
43990	18	
51530	191	

Handwritten: 822 10/03/01

February 1, 2010 10:22:21 AM

Shop Packet Print

Page 5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Page 6

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
D2651-3		Manufactured	No			230	Each	693.0000	22.0000			
O-Ring												

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

693

43849

3

46114

690

422 2/10/03/01

D3535-15 Manufactured No

230

Each

15.0000

1.0000



Wearshoe

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

15

30750

4

42233

1

53462

10

87 2/10/03/01

D3535-23 Manufactured No

230

Each

10.0000

1.0000



Wearshoe

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

10

53467

10

81 2/10/03/01

February 1, 2010 10:22:21 AM

Shop Packet Print

Page 6

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Page 7

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
IPP Rev:I 08-05-01 add QC3 DD verified by:EC
IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
D3535-37		Manufactured	No			230	Each	8.0000	1.0000			
Wearshoe												

Warehouse Loc Qty Loc Code

Location

Main Warehouse

FP

8

51654

8

D3536-15

Manufactured No

230

Each

13.0000

1.0000



Gasket

X1 M 10/03/01

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

13

51600

13

X1 M 10/03/01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
D3536-23		Manufactured	No			230	Each	16.0000	1.0000			
Gasket												

Warehouse Loc Qty Loc Code

Location

Main Warehouse

FP

3

51609

3

Main Warehouse

ST

13

30754

1

53468

12

D3536-37 Manufactured No

230

Each

10.0000

1.0000



Gasket

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

10

51641

10

xl ul w63601

xl ul 10/03/01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
D3537-1		Manufactured	No			230	Each	118.0000	6.0000			
Wearpad												

Warehouse Loc Qty Loc Code
Location

Main Warehouse

FP 2

48288 2

Main Warehouse

FP17 116

51678 16

51679 100

x6 10/03/01

D3537-3 Manufactured No

230 Each 39.0000 1.0000



Wearpad

Warehouse Loc Qty Loc Code
Location

Main Warehouse

ST 39

33881 6

35697 33

x6 10/03/01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

February 1, 2010 10:22:21 AM

Work Order ID: 55777



Parent Item: D206-642-441



Parent Item Name: Replacement Skidtube

Start Date: 2/02/10

Required Date: 2/19/10

Comments: IPP Rev:H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM
 IPP Rev:I 08-05-01 add QC3 DD verified by:EC
 IPP Rev:J 08-09-29 revF as per dwg DD verified by:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/	Replacement	Mfg/	Bin	Primary	Last	Route	Unit of	Qty on	Remaining	Qty	Date	Status
MS27039-1-08		Purchased	No			230	Each	2,482.000	2.0000			
Screw												

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

2482

110467

3

110552

479

110835

2000

x7 24 10/03/01

MS27039-4-06 Purchased No



230 Each 52.0000 1.0000



Screw

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

52

109061

52

x1 24 10/03/01

MS27039C1-08 Purchased No



230 Each 482.0000 60.0000



SCREW

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

482

19185

482

x60 24 10/03/01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

QTY -1	QTY -3	QTY -5	QTY -7	PART NUMBER	DESCRIPTION
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
17	18	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

F

F



NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: N/A
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015
- 11) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 12) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 13) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 33777
BY 10-2-01

RELEASED
08.07.23/17

F	DRAWING UPDATED TO CURRENT STANDARDS. SHT 6 ADDED. ALL SECTION AND DETAIL VIEWS TRANSFERRED TO SHT 6. SHT 1 IN PL PART D2649 QTY UPDATED. SHT 6 SECT C-C GRIND INSTRUCTIONS DELETED FROM NOTE 7 (SEE NCR 239).	AJS	08.08.08
E	REMOVE CBORE, CHG DRILL, ADD CHAMFER	CP	06.03.30
D	REDRAW; INCCRP. DE09136/9153/9163 MOD GROUND HANDLING ON D2650-1/-3	CP	04.05.17
C	CHANGE HOLE PATTERN AND FRONT END	DS	97.10.29
B	AS MANUFACTURED CHANGES	DS	97.06.26
A	NEW ISSUE	DS	97.03.25
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE USA, INC PORT HADLOCK, WA	
DRAWN	AJS		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. F
MFG. APPR.	<i>[Signature]</i>	D2650	SHEET 1 OF 6
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

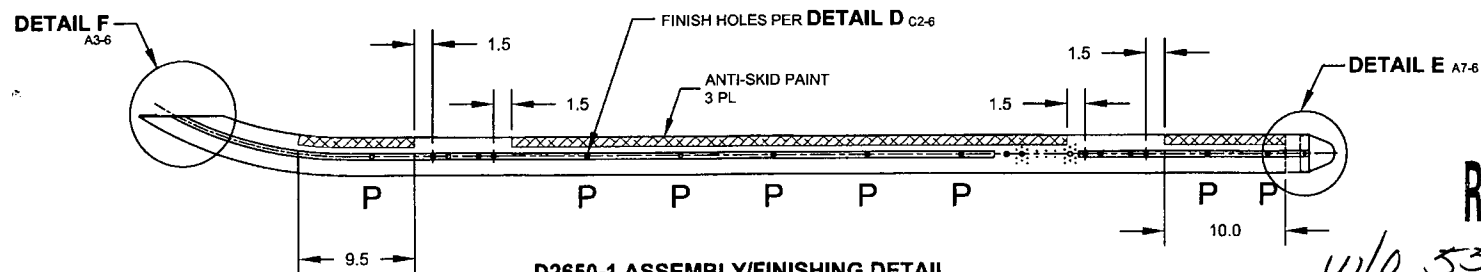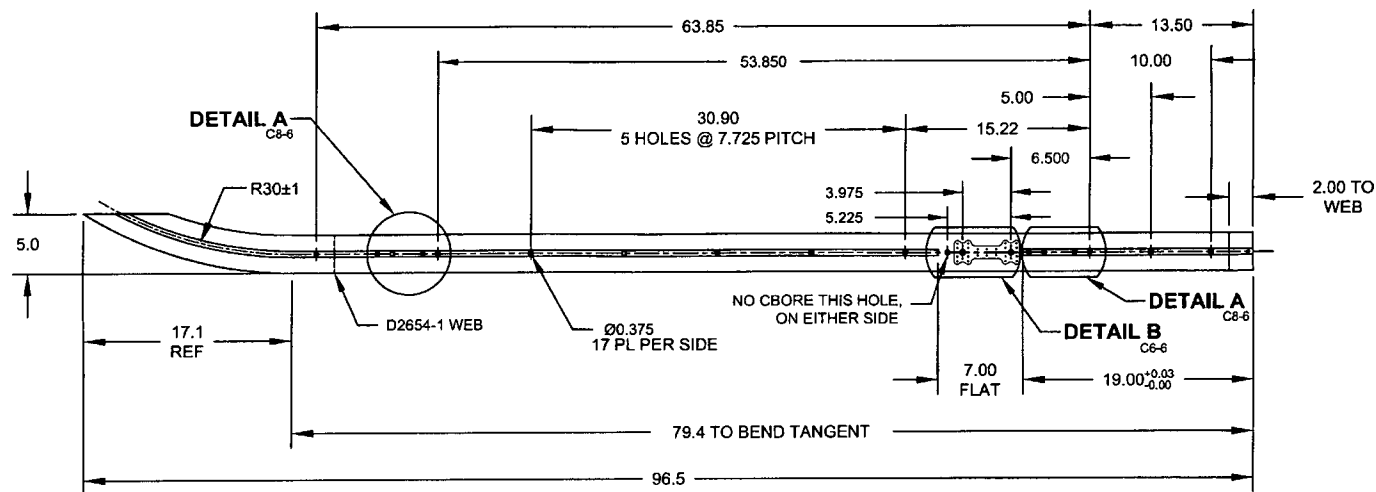

RELEASED
680922/117

W/O 55777


DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 2 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC</small>	




RELEASED
05 07 22 114

4/6 35777



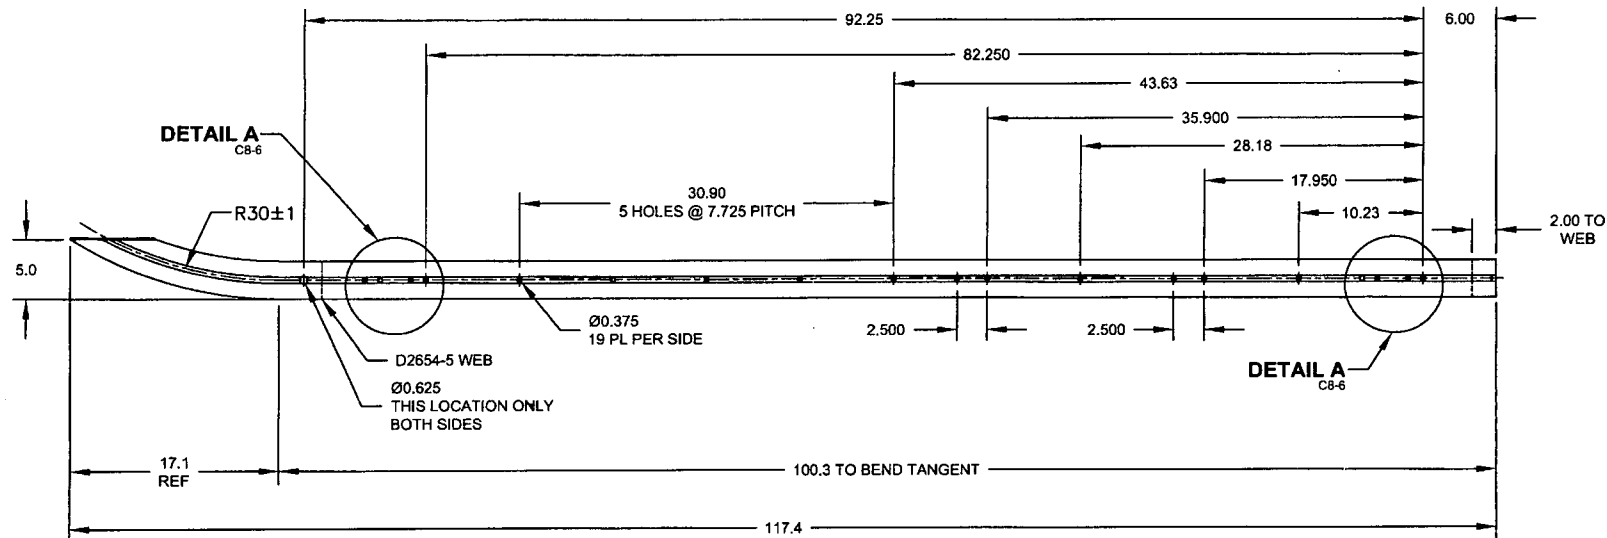

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.	<i>[Signature]</i>	D2650	SHEET 3 OF 6
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	206/407 SKIDTUBE ASSEMBLES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

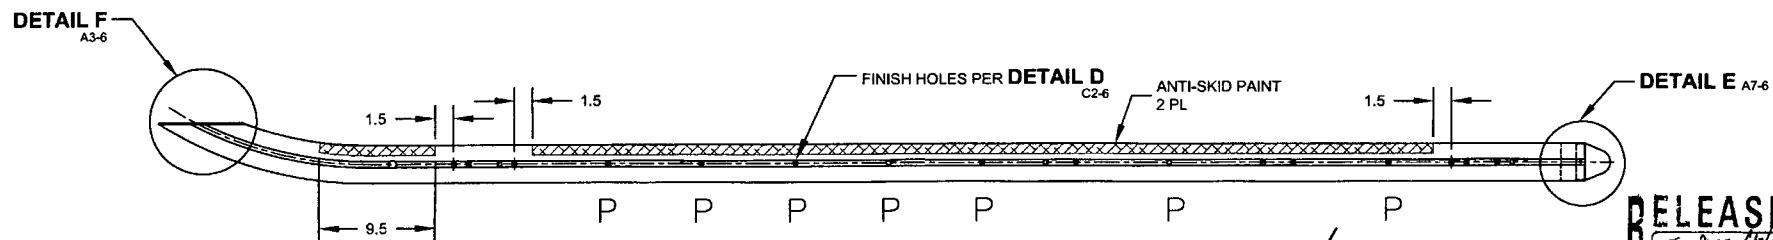


D2650-5 BENDING/DRILLING DETAIL



D2650-5 ASSEMBLY/FINISHING DETAIL


DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 4 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

RELEASED

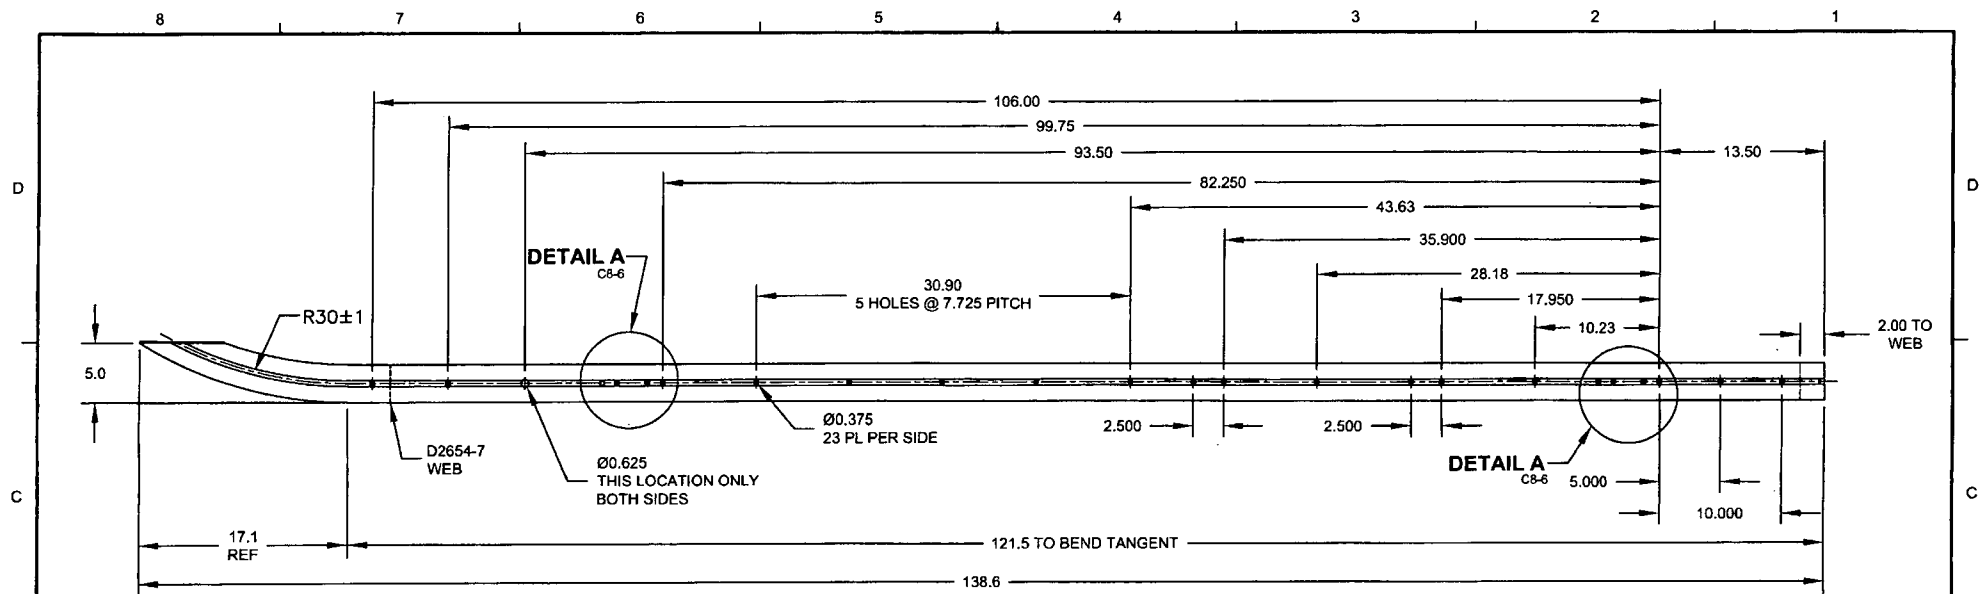

D2650-7 BENDING/DRILL DETAIL


RELEASED
02 07 22 1117

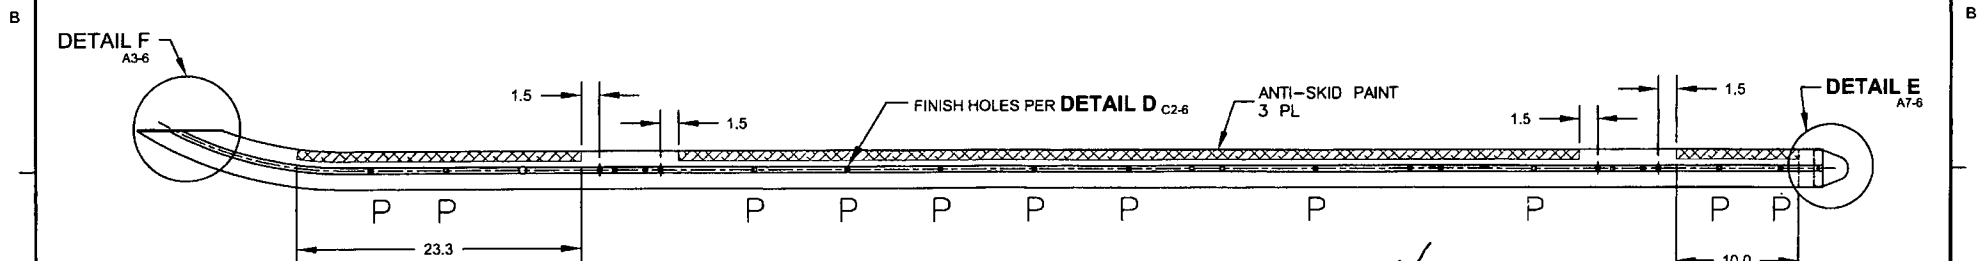


D2650-7 ASSEMBLY/FINISHING DETAIL

101055-777

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 5 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

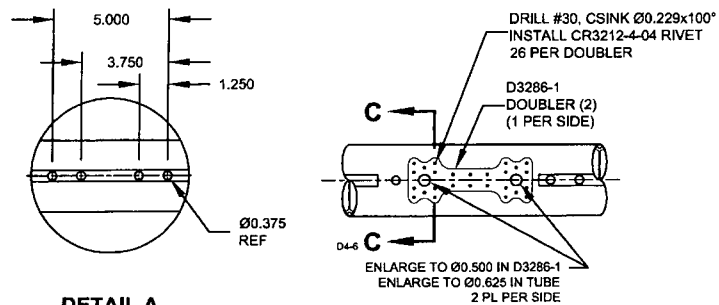


DETAIL A
SCALE 2X
C2-2
D7-2
C2-3
D7-3
C2-4
D7-4
C2-5
D8-5

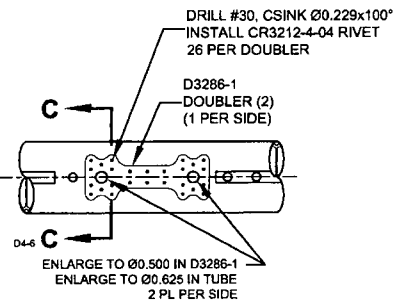


DETAIL B
SCALE 2X
C3-2
C3-3

SECTION C-C C7-6
SCALE NONE

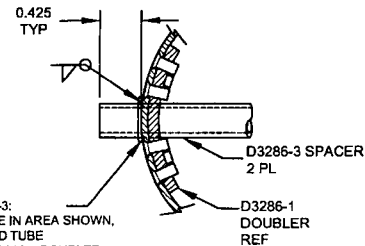


- TO INSTALL D3286-1/3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO Ø0.500
 4. ENLARGE HOLES IN TUBE TO Ø0.625 AND CHAMFER HOLE 0.030x45°
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE.

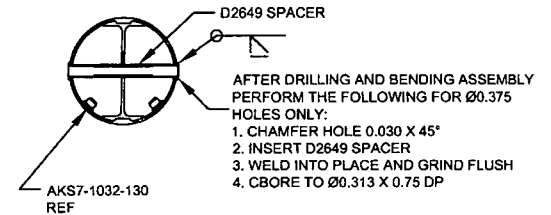


DETAIL D
FOR Ø0.375 HOLES ONLY
SCALE 3X
B4-2
B4-3
B4-4
B4-5

- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:
1. CHAMFER HOLE 0.030 X 45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. CBORE TO Ø0.313 X 0.75 DP

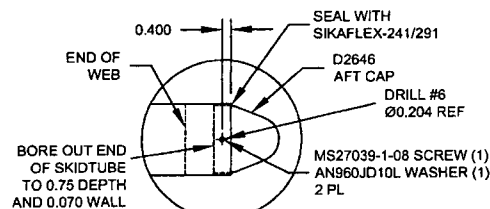

DETAIL E
SCALE 2X
B2-2
B2-3
B1-4
B1-5

ORIENTATION OF
D2680-041

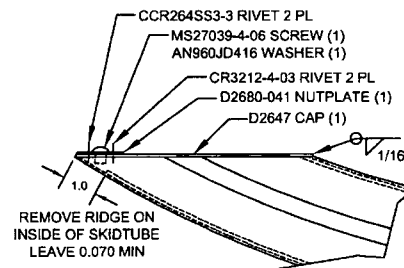

DETAIL F
SCALE NONE
B8-2
B8-3
B8-4
B8-5

DETAIL F NOTES:

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

RELEASED
08-08-08

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 6 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO. 323

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Berclay Elliott
Job number: 5577
Part number: 0206-442-441
Description: 206 skid tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier [Signature] Date of Test Coupon 10-02-16

Welder Berclay Elliott Date of Test Coupon 10-02-16

The above named individual is qualified in accordance with AWS D17.1.2001 to weld